

**STATE OF CALIFORNIA
DEPARTMENT OF INDUSTRIAL RELATIONS - DIVISION OF OCCUPATIONAL SAFETY AND HEALTH
AMUSEMENT RIDE SECTION**

☒ PAR

☐ TAR

AMUSEMENT RIDE FIELD REPORT

OFFICE 12	INSPECTOR Bobby Park	INSPECTOR I.D. P6644	DATE INSPECTED 7/25/2011	STATE I.D. NUMBER 2400
CERT/PERMIT EXPIRES	MO 8	DAY 15	YR 12	INSPECTION TIME 51:15
			INSPECTION FEE \$ 9974.25	SURVEY TYPE N1
				SPECIAL CALL N/A
AMUSEMENT PARK NAME Knott's Berry Farm			CONTACT PERSON Ramona Kinne	TELEPHONE NUMBER 714-220-5009
ADDRESS 8039 Beach Blvd.			CITY Buena Park	ZIP 90620
RESPONSIBLE PARTY Knott's Berry Farm			TELEPHONE NUMBER 714-220-5009	
ADDRESS 8039 Beach Blvd.			CITY Buena Park	STATE CA
			ZIP 90620	
AMUSEMENT RIDE NAME WindSeeker			AMUSEMENT RIDE CLASSIFICATION Class IV	
MANUFACTURER NAME Mondial			TRADE NAME Carousel on tower	
Permit Number		Tag	Validation	

Billing Information				
Date	Start Time	Finish Time	Elapsed Time	Amount Billed
7/25/2011 N1	8:15	12:00	3:45	\$731.24
7/29/2011 N1	12:00	2:30	2:30	\$487.50
8/2/2011 N1	2:00	4:30	2:30	\$487.50
8/3/2011 N1	7:45	11:00	3:15	\$633.75
8/3/2011 N1	12:00	3:00	3:00	\$585.00
8/4/2011 N1	7:30	11:30	4:00	\$780.00
8/4/2011 N1	12:30	2:30	2:00	\$390.00
8/5/2011 N1	7:30	11:30	4:00	\$780.00
8/5/2011 N1	12:30	3:30	3:00	\$585.00
8/10/2011 N1	7:30	11:30	4:00	\$780.00
8/10/2011 N1	12:30	3:30	3:00	\$585.00
8/11/2011 N1	7:30	11:30	4:00	\$780.00
8/11/2011 N1	12:30	3:30	3:00	\$585.00
8/12/2011 N1	7:30	11:30	4:00	\$780.00
8/12/2011 N1	12:30	3:30	3:00	\$585.00
8/18/2011 N1	7:30	8:00	0:30	\$97.50
8/19/2011 N1	1:15	3:00	1:45	\$341.25
		TOTAL:	51:15	\$ 9974.25

REQUIREMENTS SECTION

OVER→

See the reverse side of this form for additional requirements and comments.

ll

REQUIREMENTS SECTION

(Continued)

REQUIREMENTS EXPLAINED TO (NAME)	POSITION	TELEPHONE NUMBER
Kent Maulsby	VP Maintenance	714-220-5197

The Division conducted an Initial New Ride Inspection which is required by law on the ride known as Wind Seeker located at Knott's Berry Farm. Division QSI Park performed documentation review over several days as reflected in the time log above. Division QSI Farr and QSI Eckman performed the physical inspection of the Wind Seeker, see other field reports for their inspection information.

Note; an exceptional amount of time for this inspection is directly attributable lack of ASTM compliance, lack of manufactures compliance with self imposed certifying requirements of TUV and manufactures general lack of performance and communication. The question was asked of August Lacoco, who is responsible for compliance for Cedar Fair, parent company of Knott's Berry Farm on 8/10/2011 as to how did Cedar Fair open three identical rides earlier this summer, two in Ohio and one in Canada with out being in compliance with the minimum standards. First Mr. Lococo stated "these are DOSH issues", I explained these are the minimum ASTM standards and not even the more stringent current ASTM standards. Mr. Lacoco then stated "Monty (Jasper) took care of those". I expressed concern over this which was not appreciated. We further discussed what the current known deficiencies were with Wind Seeker at Knott's Berry Farm

Another example of an excessive waste of time is the original O&M manual was version 1. After repeated reviews of each subsequent version during the inspection process version 1.9 was developed to be compliant with ASTM, TUV requirements, and CCR's.

Another note worthy instance was the TUV report and requirements for Knott's Berry Farm were the same as the other three locations and not specific to Knott's Berry Farm at all.

I general this inspection was significantly delayed due to two reasons. The first being the manufactures initial lack of compliance and the long process to extract the compliant data and documents from the manufacture. The second being the lack of due diligence by Cedar Fair the parent company of Knott's Berry Farm considering their knowledge of ASTM as evident by membership and the other three recently installed identical rides from the same manufacture.

See attached documents which were collected during this inspection demonstrating the development of required documentation.

At the conclusion of the Division's Inspection no safety hazards were observed.

STATE OF CALIFORNIA
DEPARTMENT OF INDUSTRIAL RELATIONS - DIVISION OF OCCUPATIONAL SAFETY AND HEALTH
AMUSEMENT RIDE SECTION

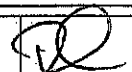


PERMANENT



TEMPORARY

AMUSEMENT RIDE FIELD REPORT

OFFICE 12	INSPECTOR Rodger Farr	INSPECTOR I.D. F4548	DATE INSPECTED August 3, 2011	STATE I.D. NUMBER PAR 2400			
CERT/PERMIT EXPIRES	MO 08	DAY 18	YR 12	INSPECTION TIME 6:00	INSPECTION FEE \$1,170.00	SURVEY TYPE N1	SPECIAL CALL N/A
AMUSEMENT PARK NAME Knott's Berry Farm				CONTACT PERSON Ramona Kinne		TELEPHONE NUMBER (714) 220-5490	
ADDRESS 8039 Beach Blvd.				CITY Buena Park		ZIP 90620	
RESPONSIBLE PARTY Knott's Berry Farm					TELEPHONE NUMBER (714) 220-5490		
ADDRESS 8039 Beach Blvd.				CITY Buena Park		STATE CA	ZIP 90620
AMUSEMENT RIDE NAME Wind Seeker				AMUSEMENT RIDE CLASSIFICATION (not classified yet)			
MANUFACTURE NAME Mondail				TRADE NAME			
Permit Number		Tag				Validation	

BILLING INFORMATION

Date	Start Time	Finish Time	Elapsed Time	Amount Billed
08-03-2011	7:30 AM	11:30 AM	4 Hrs	\$780.00
08-03-2011	12:30 PM	2:30 PM	2 Hrs	\$390.00
Total:			6 Hrs	\$1,170.00

REQUIREMENTS SECTION

REQUIREMENTS EXPLAINED TO (NAME) Mark Haywood	POSITION Ride Manager	TELEPHONE NUMBER (714) 220-5197
--	--------------------------	------------------------------------

The Division performed a New Ride Inspection (N1) on the attraction known as Wind Seeker located at Knott's Berry Farm in the City of Buena Park.

This New Ride Inspection is in conjunction with an inspection conducted by Inspector Bobby Park; this inspector conducted an inspection of the interior of the ride structure and the equipment therein, and at the conclusion of the Division's inspection, no safety hazards were observed.

END

N1 - 6 Hrs

STATE OF CALIFORNIA
DEPARTMENT OF INDUSTRIAL RELATIONS - DIVISION OF OCCUPATIONAL SAFETY AND HEALTH
AMUSEMENT RIDE SECTION



PERMANENT



TEMPORARY

AMUSEMENT RIDE FIELD REPORT

OFFICE 12	INSPECTOR Bryan Eckman	INSPECTOR I.D. E6414	DATE INSPECTED August 11, 2011	STATE I.D. NUMBER PAR 2400			
CERT/PERMIT EXPIRES	MO 08	DAY 18	YR 12	INSPECTION TIME 25 hrs	INSPECTION FEE \$4,875.00	SURVEY TYPE N1	SPECIAL CALL N/A
AMUSEMENT PARK NAME Knott's Berry Farm				CONTACT PERSON Ramona Kinne		TELEPHONE NUMBER (714) 220-5490	
ADDRESS 8039 Beach Blvd.				CITY Buena Park		ZIP 90620	
RESPONSIBLE PARTY Knott's Berry Farm						TELEPHONE NUMBER (714) 220-5490	
ADDRESS 8039 Beach Blvd				CITY Buena Park		STATE CA	ZIP 90620
AMUSEMENT RIDE NAME Windseeker				AMUSEMENT RIDE CLASSIFICATION (not classified yet)			
MANUFACTURE NAME Mondail				TRADE NAME Windseeker			
Permit Number			Tag		Validation		

BILLING INFORMATION

Date	Start Time	Finish Time	Elapsed Time	Amount Billed
08-11-2011	7:00 AM	5:00 PM	10 Hrs	\$1,950.00
08-12-2011	6:00 PM	4:00 PM	10 Hrs	\$1,950.00
08-15-2011	11:00 PM	4:00 PM	5 hrs	\$ 975.00
Total:			25 Hrs	\$4,875.00

REQUIREMENTS SECTION

REQUIREMENTS EXPLAINED TO (NAME) Mark Haywood	POSITION Ride Manager	TELEPHONE NUMBER (714) 220-5197
--	--------------------------	------------------------------------

The Division performed a New Ride Inspection (N1) on the attraction known as Windseeker located at Knott's Berry Farm in the City of Buena Park.

At the conclusion of the Division inspection, so safety hazards were observed.

END